LPS 36



200 ... 800mm

18 - 30 V 古 Ċ DC ETHERNET

hunhun

14

- Light section sensor for object • measurement
- Calibrated system
- Measurement range: 200 ... 800mm •
- Measurement time: 10ms •
- Length of laser line: max. 600mm •
- Measurement data transfer via Fast Ethernet
- Measurement value display in mm on OLED display as an alignment aid
- Optional incremental transmitter input
- Up to 376 value pairs (x,z) along the laser • line
- Up to 16 inspection tasks
- Activation input, trigger input, cascading output




Accessories:

(available separately)

- Mounting systems BT 56, BT 59
- Cable with M12 connector (K-D ...)




Dimensioned drawing

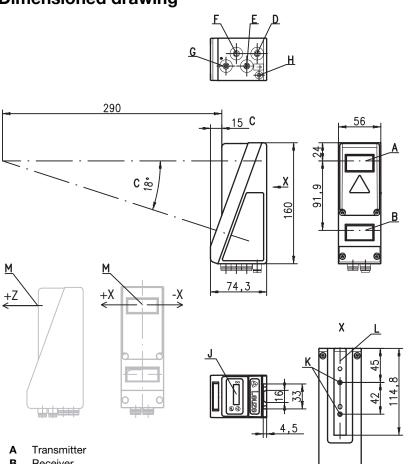

- В Receiver С
 - Optical axis
- X1: M12x1 connector, 8-pin, A coded D
- Е X2: M12x1 socket, 4-pin, D coded
- X3: M12x1 socket, 8-pin, A coded (LPS 36/EN only) F
- G X4: not used (dummy plug)
- PE screw н
- J OLED display and key pad
- Κ M4 thread, 4.5 deep L Holder for mounting system BT 56 / BT 59
- Zero point and orientation of the coordinate system for measurement data Μ

Measurement range, typical

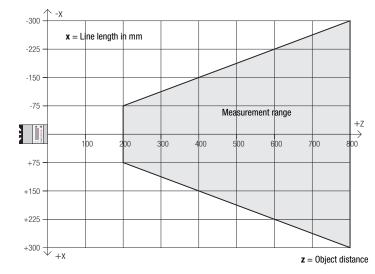

фŧ

en 06-2013/02 50111079-02

Specifications	
Optical data Measurement range ¹⁾ Light source Wavelength Max. output power Pulse duration Laser line	200 … 800mm (z direction) laser 658nm (visible red light) < 8mW 3ms 600x3mm at 800mm
Error limits (relative to measurement of	
Resolution in x direction ²) Resolution in z direction ²) Linearity in z direction ³) Repeatability in z direction ³) B/w detect. thresholds (6 90% rem.)	1 1.5mm 1 3mm ≤ ±1% ≤ 0.5% ≤ 1%
Timing Measurement time Delay before start-up	10ms approx. 1.5s
Electrical data Operating voltage U _B ⁴⁾ Residual ripple Open-circuit current Ethernet interface Switching outputs Inputs Signal voltage high/low Indicators	18 30VDC (incl. residual ripple) $\leq 15\%$ of U _B $\leq 200mA$ UDP 1 (ready) / 100mA / push-pull ⁵⁾ on X1 1 (cascading) / 100mA / push-pull ⁵⁾ on X1 1 (trigger) on X1 1 (activation) on X1 \geq (U _B -2V)/ \leq 2V
Green LED continuous light off Yellow LED continuous light flashing off	ready no voltage Ethernet connection available Ethernet data transmission active no Ethernet connection available
Mechanical data Housing Optics cover Weight Connection type	aluminum frame with plastic cover glass 620g M12 connector
Environmental data Ambient temp. (operation/storage) Protective circuit ⁶⁾ VDE safety class Protection class Laser class Standards applied	-30°C +50°C/-30°C +70°C 1, 2, 3 III, protective extra-low voltage IP 67 2M (according to EN 60825-1 and 21 CFR 1040.10 with Laser Notice No. 50) IEC/EN 60947-5-2, UL 508

Luminosity coefficient 6% ... 90%, entire measurement range, at 20°C after 30 minutes warmup time, medium range UB 1)

Minimum and maximum value depend on measurement distance 2)

3) Reflectivity 90%, identical object, identical environment conditions, measurement object $\ge 50 \times 50 \text{ mm}^2$

4) For UL applications: for use in class 2 circuits according to NEC only

The push-pull switching outputs must not be connected in parallel 5) 6) 1=transient protection, 2=polarity reversal protection, 3=short circuit protection for all outputs

Interface assignments

X1 - logic and power				
Pin No.	Signal	Color		
1	+24VDC	WH		
2	InAct (activation)	BN		
3	GND	GN		
4	OutReady (ready)	YE		
5	InTrig (trigger)	GY		
6	OutCas (cascading)	PK		
7	Do not connect	BU		
8	Do not connect	RD		
9-nin M12 nlug A coded				

8-pin M12 plug, A coded

Order guide

Line profile sensor Without encoder interface With encoder interface

LPS 36... - 06

PIN NO.	Signal	Color
1	Tx+	YE
2	Rx+	WH
3	Tx-	OR
4	Rx-	BU

Designation

LPS 36

LPS 36/EN

X3 - encoder				
Pin No.	Signal	Color		
1	Enc. +24VDC	WH		
2	(GND)	BN		
3	GND	GN		
4	Enc. A+	YE		
5	Enc. A-	GY		
6	Enc. B+	PK		
7	Enc. B-	BU		
8	+5VDC Out	RD		
8-pin M12 socket, A coded				

Part No.	
50111325	


▲ Leuze electronic

Tables


LPS 36

10.0								
LED	State	Display during measurement operation						
green	continu-	Sensor						
	ous light	ready						
	off	Sensor not ready						
yellow	continu-	Ethernet connection						
	ous light	established						
	flashing	Ethernet data						
		transmission active						
	off	No Ethernet						
		connection						

Diagrams

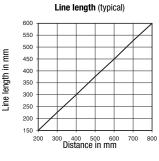

Resolution (typical)



Remarks

Approved purpose This product may only be used by qualified personnel and must only be used for the approved purpose. This sensor is not a safety sensor and is not to be used for the protection of persons.

Warmup time:

After a warmup time of 30 min., the light section sen-sor has reached the operating temperature required for an optimum measurement.

Encoder interface (LPS 36/EN): 24V single ended

(A+, B+) or 5V differential (A+/A-, B+/B-) Current consumption max. 140mA, pulse frequency max. 300kHz

For UL: CAUTION - Use of controls or adjustments or performance of procedures other than specified herein may result in hazardous light exposure.

2013/02

Line profile sensor

LPS 36

Establish connection to PC

The LPS is configured via a PC using the LPSsoft program before it is integrated into the process control.

In order to be able to establish an UDP communication with the PC, the IP address of your PC and the IP address of the LPS must lie in the same address range. The LPS has no built-in DHCP client, so that you need to set the address manually. This is done the easiest way via the PC.

O Notice!

٦

If you are using a desktop firewall, please ensure that the control can communicate with the LPS via the Ethernet interface on ports 9008 and 5634 using UDP. Furthermore, the firewall must allow ICMP echo messages to pass through for the connection test (ping).

If the PC is usually connected to a network using DHCP address allocation, the easiest way to access the LPS is by applying an alternative configuration in the TCP/IP settings of the PC and connecting the LPS directly to the PC.

♦ Check the network address of the LPS by pressing the → button on the key pad of the sensor during normal operation of the LPS twice in succession, then by pressing ▼ twice and followed by pressing the → button again.

This will take you to the Ethernet submenu and enable you to read the current settings of the LPS consecutively when pressing ▼ repeatedly.

Solution Make a note of the values for IP-Address and Net Mask Addr...

The value in Net Mask Addr. specifies which digits of the IP address of the PC and LPS must match so that they can communicate with each other.

Address of the LPS	Net mask	Address of the PC
192.168.060.003	255.255.255.0	192.168.060.xxx
192.168.060.003	255.255.0.0	192.168.xxx.xxx

Instead of **xxx** you can now allocate any numbers between 000 and 255 to your PC, but NOT THE SAME numbers as contained in the address of the LPS.

For example 192.168.060.110 (but not 192.168.060.003!). If LPS and PC have the same IP address, they cannot communicate with each other.

Configuring the IP address for a PC

- ♦ Log in to your PC as an administrator.
- & Using Start->System control go to the Network connections (Windows XP) menu or to the Network center and release center (Windows Vista) menu.
- Stress Stress
- Select the Internet Protocol (TCP/IP) (by scrolling down, if necessary) and click on Properties.
- % In the Internet protocol (TCP/IP) Properties window select the Alternate configuration tab.
- © Configure the IP address of the PC in the address range of the LPS. **Attention:** do not use the same as for the LPS!
- & Set the Subnet mask of the PC to the same value as the one for the LPS.
- ♦ Close the configuration dialog by confirming all windows using □K.
- Connect the interface X2 of the LPS directly to the LAN port of your PC. Use a KB ET-...-SA-RJ45 cable for the connection.

Local Ar	ea Connection Prope ? 🔀
General Advance	ed
Connect using:	
💵 NVIDIA n	Force Networking Controller Configure
This connection	uses the following items:
	designed for the control of the second secon
🗹 📮 Qo S Pa	acket Scheduler
Interne	t Protocol (TCP/IP)
<	
l <u>n</u> stall	Internet Protocol (TCP/IP) Properties 김
- Description -	General Alternate Configuration
Transmissio wide area n	You can get IP settings assigned automatically if your network supports
across diver	this capability. Otherwise, you need to ask your network administrator for the appropriate IP settings.
Sho <u>w</u> icon	the appropriate in settings.
✓ Notify me w	Obtain an IP address automatically
	Use the following IP address:
	IP address:
	Sybnet mask:
	Default gateway:
	 Obtain DNS server address automatically
	O Use the following DNS server addresses:
	Preferred DNS server:
	Alternate DNS server:
	Advanced
	OK Cancel

The PC will first try to establish a network connection via the automatic configuration. This will take a few seconds. Following that the alternative configuration, which you have just set up, is activated,

and thus the PC can communicate with the LPS.

Information about configuring the LPS using **LPSsoft** software can be found in the Technical Description.

LPS 36

Commissioning

For the commissioning and integration of the sensor in the process control the following steps are necessary:

- 1. Configuring the LPS see chapter 8 of the Technical Description.
- 2. Programming process control see chapter 9 of the Technical Description.
- 3. Adapt the IP configuration of the LPS such that it can communicate with the process control. This can be done either via the display of the LPS or in LPSsoft in the Configuration area. Here you can change network address and associated net mask as well as the ports via which the LPS communicates with process control.

- IP Configuration			Client / PC	
IP Address:	192.168.60.3		Port:	5634
Port:	9008			
Subnet Mask:	255.255.255.0			
Accept		Check Conr	nectivity	Use Presets

4. Save the changed settings in the LPS using the Configuration->Transmit to sensor command.

5. Connect LPS to process control via the Ethernet interface.

6. Establish connections for activation, triggering and cascading, if necessary.

Installing the software

System requirements

The PC used should meet the following requirements:

- Pentium[®] or faster Intel[®] processor > 1.5 GHz (Pentium 4, Celeron, Xeon) or compatible models by AMD[®] (Athlon 64, Opteron, Sempron). The processor must support the SSE2 instruction set.
- At least 512 MB free main memory (RAM), 1024 MB recommended
- CD-ROM drive
- Hard disk with at least 1 GB available memory
- Ethernet port
- Microsoft® Windows XP SP2/3 / Vista SP1

Installation procedure

Notice!

 \cap

Ο

٦

If present, uninstall Matlab Runtime before beginning with the installation of the LXSsoft Suite.

The LXSsoft Suite Setup.exe installation program is located on the supplied CD.

Notice!

Copy this file from the CD to an appropriate folder on your hard drive.

Administrator privileges are required for the next steps.


- Start the installation process, double-click on file LXSsoft Suite Setup.exe.
- ♦ In the first window, click on Next.

In the next window, you can select whether you would like to install **LPSsoft** only, or **LRSsoft** in addition.

You will need **LRSsoft** in addition, for configuring light section sensors of the LRS series with your PC.

You cannot deselect the first option, MATLAB Compiler Runtime, since this component is needed in all cases.

Select the desired options and click on Next and, in the next window, click on Install.

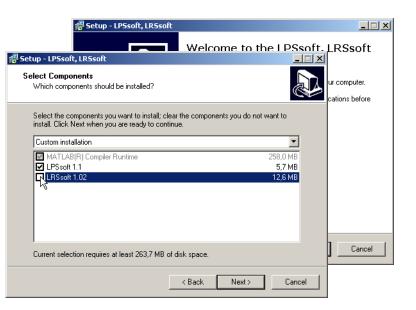

▲ Leuze electronic

Line profile sensor

LPS 36

The installation routine starts. After a few seconds, the window for selecting the installation language for the Matlab Compiler Runtime (MCR) appears. The MCR is used for 3D visualization in **LPSsoft**. It is only available in English or Japanese.

 Therefore keep in the Choose Setup Language window the selection English and click on OK.

Depending on the configuration of your Windows system the adjacent dialog can also appear (missing component VCREDIST_X86).

♦ Click on Install.

Two additional installation windows will appear, which do not require any further entry.


After some time (up to several minutes depending on the system configuration) the start screen of the MCR installer will appear.

& Click on Next.


The window for entering user data appears.

- Enter your name and the company name and then click on Next.
- It is essential that you retain the default folder in the window for the selection of the installation path (Destination Folder).
- The standard path is
- C:\Programs\MATLAB\MATLAB Compiler Runtime\.

~~~ & ~~ Click ~on Next and in the next window click on <code>Install</code>.

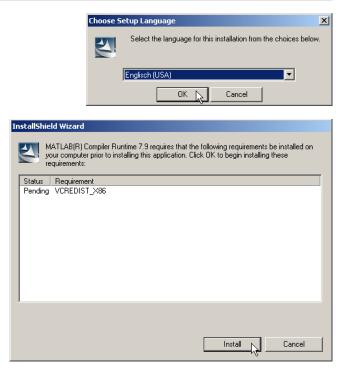



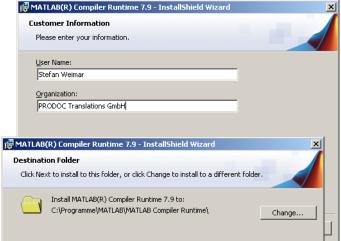

# ▲ Leuze electronic

## **LPS 36**

The installation will start and the adjacent status window will be displayed. This can again take several minutes.

Following successful MCR installation, the InstallShield Wizard Completed window appears.

 $~~~ \mbox{ } \mbox$ 

|    | 👘 MATLA                                                | .B(R) C | ompiler F                | luntime   | 7.9 - InstallS                      | hield W | /izard      |         |        | _ 🗆 🗵 |
|----|--------------------------------------------------------|---------|--------------------------|-----------|-------------------------------------|---------|-------------|---------|--------|-------|
|    | Installi                                               | ng MA   | TLAB(R) (                | ompiler   | Runtime 7.9                         |         |             |         |        |       |
|    | The program features you selected are being installed. |         |                          |           |                                     |         |             |         |        |       |
|    | 15                                                     |         |                          |           | stallShield Wiza<br>ake several mir |         | lls MATLAB( | R) Comp | viler  |       |
| 17 | MATLAB(R)                                              | ) Com   | piler Runt               | ime 7.9 - | InstallShiel                        | l Wizar | 'd          |         |        | ×     |
| 1  | MAT<br>Comp                                            |         | B <sup>.</sup><br>untime | Insta     | llShield Wiz                        | ard Co  | ompleted    |         |        |       |
|    |                                                        |         |                          |           | itallShield Wiza<br>er Runtime 7.9. |         |             |         |        |       |
|    |                                                        |         |                          |           |                                     |         |             |         |        |       |
|    |                                                        |         |                          |           |                                     |         |             |         |        |       |
|    |                                                        |         |                          |           |                                     |         |             |         |        |       |
| -  | 🃣 The M                                                | athW    | orks                     |           |                                     |         |             |         |        |       |
|    |                                                        |         |                          |           | < Back                              |         | Finish      | 7       | Cancel |       |

The window for selecting the installation path for **LPSsoft** now appears.

♦ Keep the default folder and click on Next.

The installation of **LPSsoft** starts. If you also selected **LRSsoft** for installation, upon completion of the **LPSsoft** installation, the same window then reappears for entering the installation path for **LRSsoft**.


♦ Keep the default folder in this case as well and click on Next.

| 7 Setup - LRSsoft                                                 |                      |                |                 |
|-------------------------------------------------------------------|----------------------|----------------|-----------------|
| Select Destination Location<br>Where should LRSsoft be installed? |                      |                |                 |
| Setup will install LRSsoft into the fol                           | lowing folder.       |                |                 |
| To continue, click Next. If you would like to s                   | elect a different fo | older, click B | rowse.          |
| C:\Programme\Leuze electronic\LRSsoft                             |                      |                | B <u>r</u> owse |
|                                                                   |                      |                |                 |
|                                                                   |                      |                |                 |
|                                                                   |                      |                |                 |
|                                                                   |                      | $\mathbb{R}$   |                 |
| At least 14,2 MB of free disk space is require                    | <b>d</b> .           |                |                 |
|                                                                   | < <u>B</u> ack       | <u>N</u> ext > | Cancel          |

Upon completion of the installation process, the adjacent window appears.

The installation routine added a new Leuze electronic program group in your Start menu that contains the installed programs LPSsoft and, if selected, LRSsoft.

Click on Finish and then start the desired program from the Start menu.

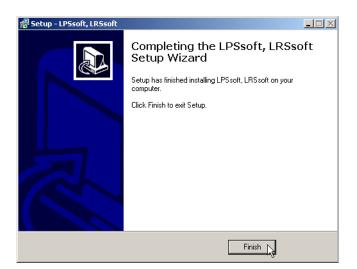

# Leuze electronic

Line profile sensor

## LPS 36

#### Possible error message

Depending on the system configuration the adjacent error message can appear at this point.

The cause of this error message is a bug in the MCR installation routine, which does not set the environment variable Path correctly in some systems.

LPS\_Visualization.exe - Komponente nicht gefunden

That, however, can easily be corrected without reinstallation of the MCR.

- \$ Open the System properties window located in the System control of Windows under System.
- Go to the Advanced tab and click on Environment variables.

The Environment variables window opens.


- & Scroll down in the System variables area until you
  find the Path entry.
- ⇔ *Click on* Path *and then on* Edit.

The Edit system variable window opens.

There in the Variable value field you will find the ;C:\Programs\MATLAB\MATLAB Compiler Runtime\v79\runtime\win32 entry right at the end.

- If this entry is missing, copy the entry from this document and insert it together with the preceding semicolon.
- 5 Then click on ок and close also all further windows using ок.
- Shut Windows down, restart Windows and then start LPSsoft by double-clicking on it.

Now the start screen of **LPSsoft** appears, as described in chapter 8 of the technical description LPS.

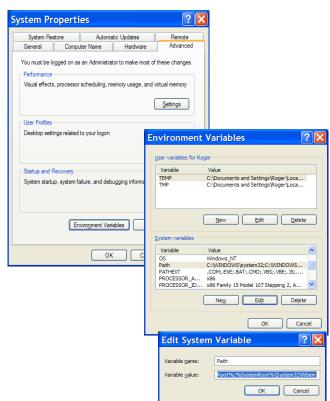

# ▲ Leuze electronic

LPS 36